# **HONDA** Service Bulletin



Applies To: 2000–01 S2000 – ALL

2002 S2000 - From VIN JHMAP1...2T000001 thru JHMAP1...2T000006

October 29, 2002

## **Rear Vibration During Acceleration**

### SYMPTOM

When accelerating at any speed above 30 mph, a vibration can be felt through the seats from the rear of the car. If you lift your foot off the throttle or decelerate, there is no vibration.

#### **PROBABLE CAUSE**

The CV joint housing is damaged.

#### **CORRECTIVE ACTION**

Replace both inboard CV joints.

#### PARTS INFORMATION

Inboard Boot Band (2 required): P/N 44327-SV4-305, H/C 5316781

Inboard Joint (2 required): P/N 42320-S2A-310, H/C 6237010

#### WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Operation Number: 220115 – Both sides

Flat Rate Time:	2.0 hours
Failed Part:	P/N 42320-S2A-310 H/C 6237010
Defect Code:	045
Contention Code:	B99
Template ID:	02-063A
Skill Level:	Repair Technician

**Out of warranty:** Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

#### **REPAIR PROCEDURE**

- Refer to pages 16-3 through 16-16 of the 2000–2003 S2000 Service Manual to replace the inboard CV joint.
- 2. Repeat the procedure for the opposite side of the vehicle.
- 3. Test-drive the car to make sure the vibration felt when accelerating above 30 mph is gone.

© 2002 American Honda Motor Co., Inc. – All Rights Reserved

ATB 24606 (0210)

