



**Convertible Top Cover Snap Is Broken**  
(Supersedes 03-014, dated February 25, 2003)

**SYMPTOM**

One or more of the snaps that secure the convertible top cover are broken.

**PROBABLE CAUSE**

Incorrect use of the snaps by forcing the snap onto the pin without pulling out on the button.

**CORRECTIVE ACTION**

Replace the snap(s).

**PARTS INFORMATION**

Short Snap:  
P/N 90316-S2A-000, H/C 6245336

Long Snap:  
P/N 90318-S2A-000, H/C 6385769

**REQUIRED MATERIALS**

Hondalock 2 (one bottle will do 100 repairs):  
P/N 08713-0002, H/C 2963833

**WARRANTY CLAIM INFORMATION**

**In warranty:** The normal warranty applies.

Operation Number: 814136

Flat Rate Time: 0.2 hour

Failed Part: P/N 90316-S2A-000  
H/C 6245336

Defect Code: 01801

Symptom Code: 00101


Skill Level: Repair Technician

**Out of warranty:** Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.



**REPAIR PROCEDURE**

1. Inspect the inside of each snap to determine which ones need replacing.


*'00-01 Models:*

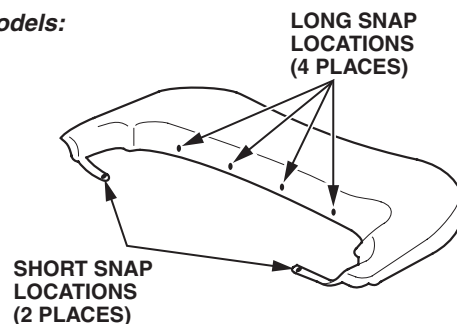

*'02-04 Models:*

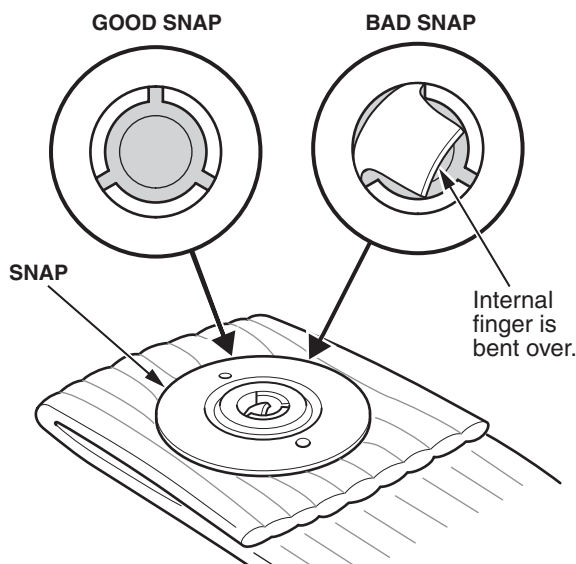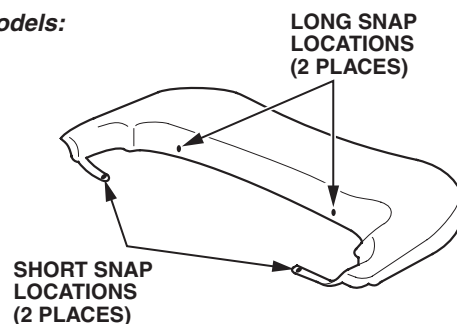

2. Use snap-ring pliers to remove the damaged snap(s) from the convertible top cover.

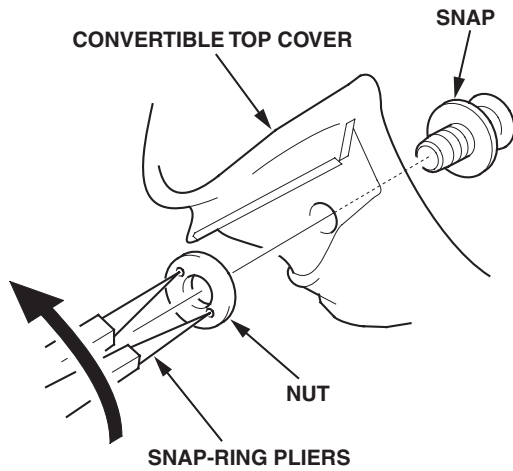

3. Apply Hondalock 2 to the threads, and then install the new snap(s).
4. Inform the customer of the proper way to use the snaps.

**NOTE:** When installing or removing the convertible top cover, the button on the snap must be pulled out to install the snap onto the pin or to release the snap from the pin.

