

HONDA Service Bulletin



Applies To: See VEHICLES AFFECTED

May 21, 2009

Convertible Top Is Torn at the Lock Handle and/or the Right Rear

SYMPTOM

The convertible top is torn at one or both lock handles and/or the right rear area.

PROBABLE CAUSE

There is a rough surface on the lock handle and/or the right rear frame hinge.

VEHICLES AFFECTED

For the following VIN ranges, the convertible top may be torn at the right rear area:

2005-07 S2000 - ALL

2008 S2000 -

From VIN JHMAP....8S000001 thru JHMAP....8S002446

For the following VIN ranges, the convertible top may be torn at the front lock assembly:

2005-08 S2000 - ALL

2009 S2000 -

From VIN JHMAP....9S000001 thru JHMAP....9S000096

CORRECTIVE ACTION

Replace the convertible top cloth and one or both lock handles, and remove any rough spots on the right rear frame hinge.

PARTS INFORMATION

Aluminum Washer (11 required):

(commercially available)

Brass Rivets (11 required):

P/N 86320-S2A-003, H/C 6244560

Cloth Top Assembly:

P/N 86310-S2A-J03, H/C 8800005

Double-Sided Tape:

P/N 86022-S2A-003, H/C 6244214

Pop Rivet (Two required):

P/N 86006-S2A-003, H/C 6244032

Pop Rivet, 3/16"x 3/8" (11 required):

(commercially available)

Right Side Lock Assembly:

P/N 86250-S2A-J01, H/C 6857346

Left Side Lock Assembly:

P/N 86260-S2A-J01, H/C 6857353

TOOL INFORMATION

Eye protection

4 mm drill bit

Drill

Body vise grip pliers or pop rivet gun

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

OP#	Description	FRT
814129	Replace the top cloth assembly.	7.5
8171D6	Replace the lock handle on one side.	0.2
Α	Replace the lock handle on one additional side.	0.2
8230B4	Remove the burrs, and paint the frame hinge.	0.3

Failed Part: P/N 86310-S2A-J03

H/C 8800005

Defect Code: 07701 Symptom Code: 02602

Skill Level: Repair Technician

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

© 2009 American Honda Motor Co., Inc. - All Rights Reserved

ATB 41469 (0905)

1 of 3

